


Trouble Shooting

Permanent lock out (H87) reset procedure for Thermotop EVO using Multicontrol

- 1) Repair/rectify the original source fault
- 2) Turn off the heater using the smart/multicontrol
- 3) Remove 20A Fuse
- 4) Wait 30 seconds
- 5) Refit 20A Fuse
- 6) Wait 30 seconds
- 7) Turn Heater on using the smart/multicontrol
- 8) Remove 20A fuse between 3 and 10 Seconds
- 9) Wait 30 seconds
- 10) Refit 20A Fuse
- 11) Turn off the heater using the smart/multicontrol
- 12) Carry out reset of the multicontrol
- 13) Wait 30 seconds
- 14) Turn Heater on- Procedure Complete

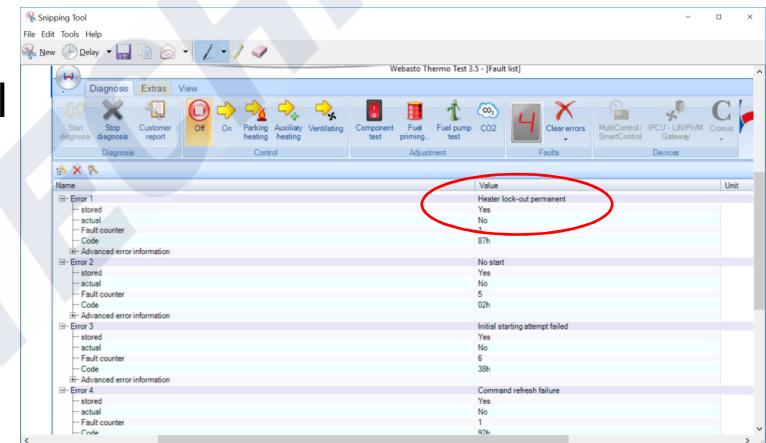

The lockout can also be released using the PC Diagnosis